

AD-A032 574

AIR FORCE PACKAGING EVALUATION AGENCY WRIGHT-PATTERSON--ETC F/G 6/12  
AIRTIGHTNESS TEST OF CASKET FOR HUMAN REMAINS.(U)  
OCT 76 D A EDWARDS  
PTPD-76-36

UNCLASSIFIED

NL

| OF |  
AD  
A032574



END  
DATE  
FILMED  
1-77

AD A032574

APPROVED FOR PUBLIC RELEASE  
DISTRIBUTION UNLIMITED

PTPD REPORT NO. 76-36  
AFPEA PROJECT NO. 76-P7-55

12  
B.S.

DARYL A. EDWARDS  
Engineering Technician

Autovon 787-3120  
Commercial (513) 257-3120

DDC  
RECEIVED  
NOV 26 1976  
C

AIRTIGHTNESS TEST OF CASKET FOR HUMAN REMAINS

AFALD/PTP  
AIR FORCE PACKAGING EVALUATION AGENCY  
Wright-Patterson AFB OH 45433

October 1976

DISTRIBUTION STATEMENT A  
Approved for public release;  
Distribution Unlimited

## NOTICE

When government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related government procurement operation, the United States Government thereby incurs no responsibility whatsoever; and the fact that the government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto. This report is not to be used in whole or in part for advertising or sales purposes.

## ABSTRACT

A test for airtightness utilizing the Halogen Leak Detector was performed on a casket for human remains as requested by AFLC/DEHM (Memorial Affairs Division). The casket was a Batesville R58-845-A sealer casket serial No. L-47446 supplied by the Batesville Casket Company, Inc., located in Batesville, Indiana. Although the casket leaked at one spot, it was concluded that satisfactory airtightness performance may readily be achieved.

ACQUISITION	
NTIS	White Section <input checked="" type="checkbox"/>
AD	Blue Section <input type="checkbox"/>
UNCLASSIFIED	<input type="checkbox"/>
CLASSIFICATION	<input type="checkbox"/>
BY	
DISTRIBUTION/AVAILABILITY CODE	
DISC.	AVAIL. S. <input type="checkbox"/>
A	

PREPARED BY:

*Daryl A. Edwards*  
DARYL A. EDWARDS  
Engineering Technician  
Design Division

REVIEWED BY:

*Ralph Zynda*  
RALPH ZYNDA  
Chief, Design Division  
Air Force Packaging  
Evaluation Agency

PUBLICATION DATE:

27 October 1976

APPROVED BY:

*Jack E. Thompson*  
JACK E. THOMPSON  
Director  
Air Force Packaging  
Evaluation Agency

## TABLE OF CONTENTS

	Page
ABSTRACT. . . . .	1
TABLE OF CONTENTS . . . . .	111
INTRODUCTION. . . . .	1
Purpose. . . . .	1
Background . . . . .	1
TEST SPECIMEN AND EQUIPMENT . . . . .	1
Description of Test Specimen . . . . .	1
Test Equipment . . . . .	1
TEST PROCEDURES AND RESULTS . . . . .	1
Procedure. . . . .	1
Results and Discussion . . . . .	2
CONCLUSIONS AND RECOMMENDATIONS . . . . .	2
ILLUSTRATIONS:	
Figure 1. Leakage Point . . . . .	3
Figure 2. Leakage Path. . . . .	4
DISTRIBUTION LIST . . . . .	5
DD FORM 1473. . . . .	7



## INTRODUCTION

PURPOSE: The purpose of this test was to evaluate the supplied casket for airtightness in accordance with requirements set forth in Air Force Specification, Care of Remains of Deceased Personnel, Amendment 5, Revised March 1976. The test was performed on 6 August 1976 at the Air Force Packaging Evaluation Agency (AFPEA). Testing was witnessed by Mr. Cam Beauchemin, AFLC/DEHM, and Mr. John F. Metz, Batesville Casket Company, Inc.

BACKGROUND: The casket sample submitted to the AFPEA for testing was provided by the Batesville Casket Company, Inc. This casket is presently being proposed by prospective contract funeral directors. Testing for airtightness was performed to determine if the sealing requirement presented in the Air Force specification is satisfied.

## TEST SPECIMEN AND EQUIPMENT

DESCRIPTION OF TEST SPECIMEN: The test specimen is a Batesville, R58-845-A, sealer casket serial No. L-47446. The casket is constructed of Monogard 20 gauge steel. Outside dimensions of the casket are 83 x 28 x 23 inches.

TEST EQUIPMENT: Low Temperature Chamber - Tenney Engineering Company. Halide Gas Leak Detector - Turner Company, Model LP777.

## TEST PROCEDURES AND RESULTS


PROCEDURE: The open casket, with all bedding material removed, was first cooled 20 degrees below ambient temperature (Fahrenheit) in the low temperature chamber for 30 minutes. While still in the chamber, some dichlorodifluoromethane refrigerant gas (Kaiser 12) was released into the casket and the lids drawn shut. The casket was then removed from the chamber and placed on a pallet in front of a large fan for 10 minutes. The fan served to disperse any residual gas concentrations about the casket and also expedite warming up of the casket. Warming up of the casket (20 degrees) to ambient temperature was calculated to induce an internal pressure of about 0.75 pounds per square inch to

assist in detecting any leakage. The Halide Gas Leak Detector was moved along all seams, welds, and closures of the entire casket.


RESULTS AND DISCUSSION: The test results indicated the presence of one leak located as shown in Figure 1. Initial observations attributed the probable cause of leakage to misalignment of the two lids. Lid misalignment was obvious as both lids failed to line up "flush" at their interface. Further examination revealed that leakage occurred through the gap which would normally be filled by the gasket between the lids. Lid misalignment aggravated the seal by causing a larger cavity at the point of leakage and prevented the gasket from completely filling the cavity (see Figure 2).

#### CONCLUSIONS AND RECOMMENDATIONS

It was concluded that the casket submitted for test is adequately manufactured to achieve the structural integrity necessary for airtightness. It is, however, recommended that the lid gasket design be lengthened so that any slight misalignment of the lids will not affect the airtightness feature of the casket.

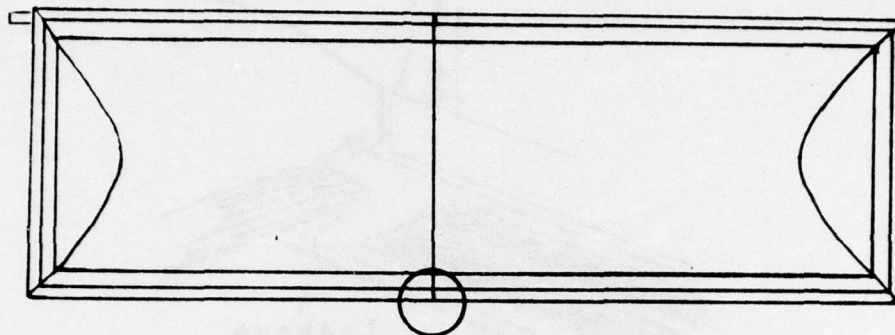

TOP VIEW

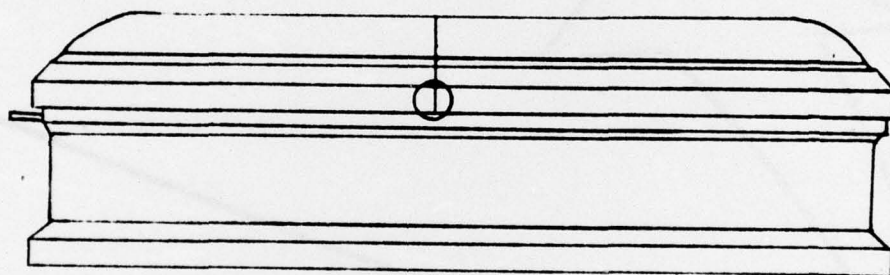


BACK VIEW

Leakage Point

FIGURE 1



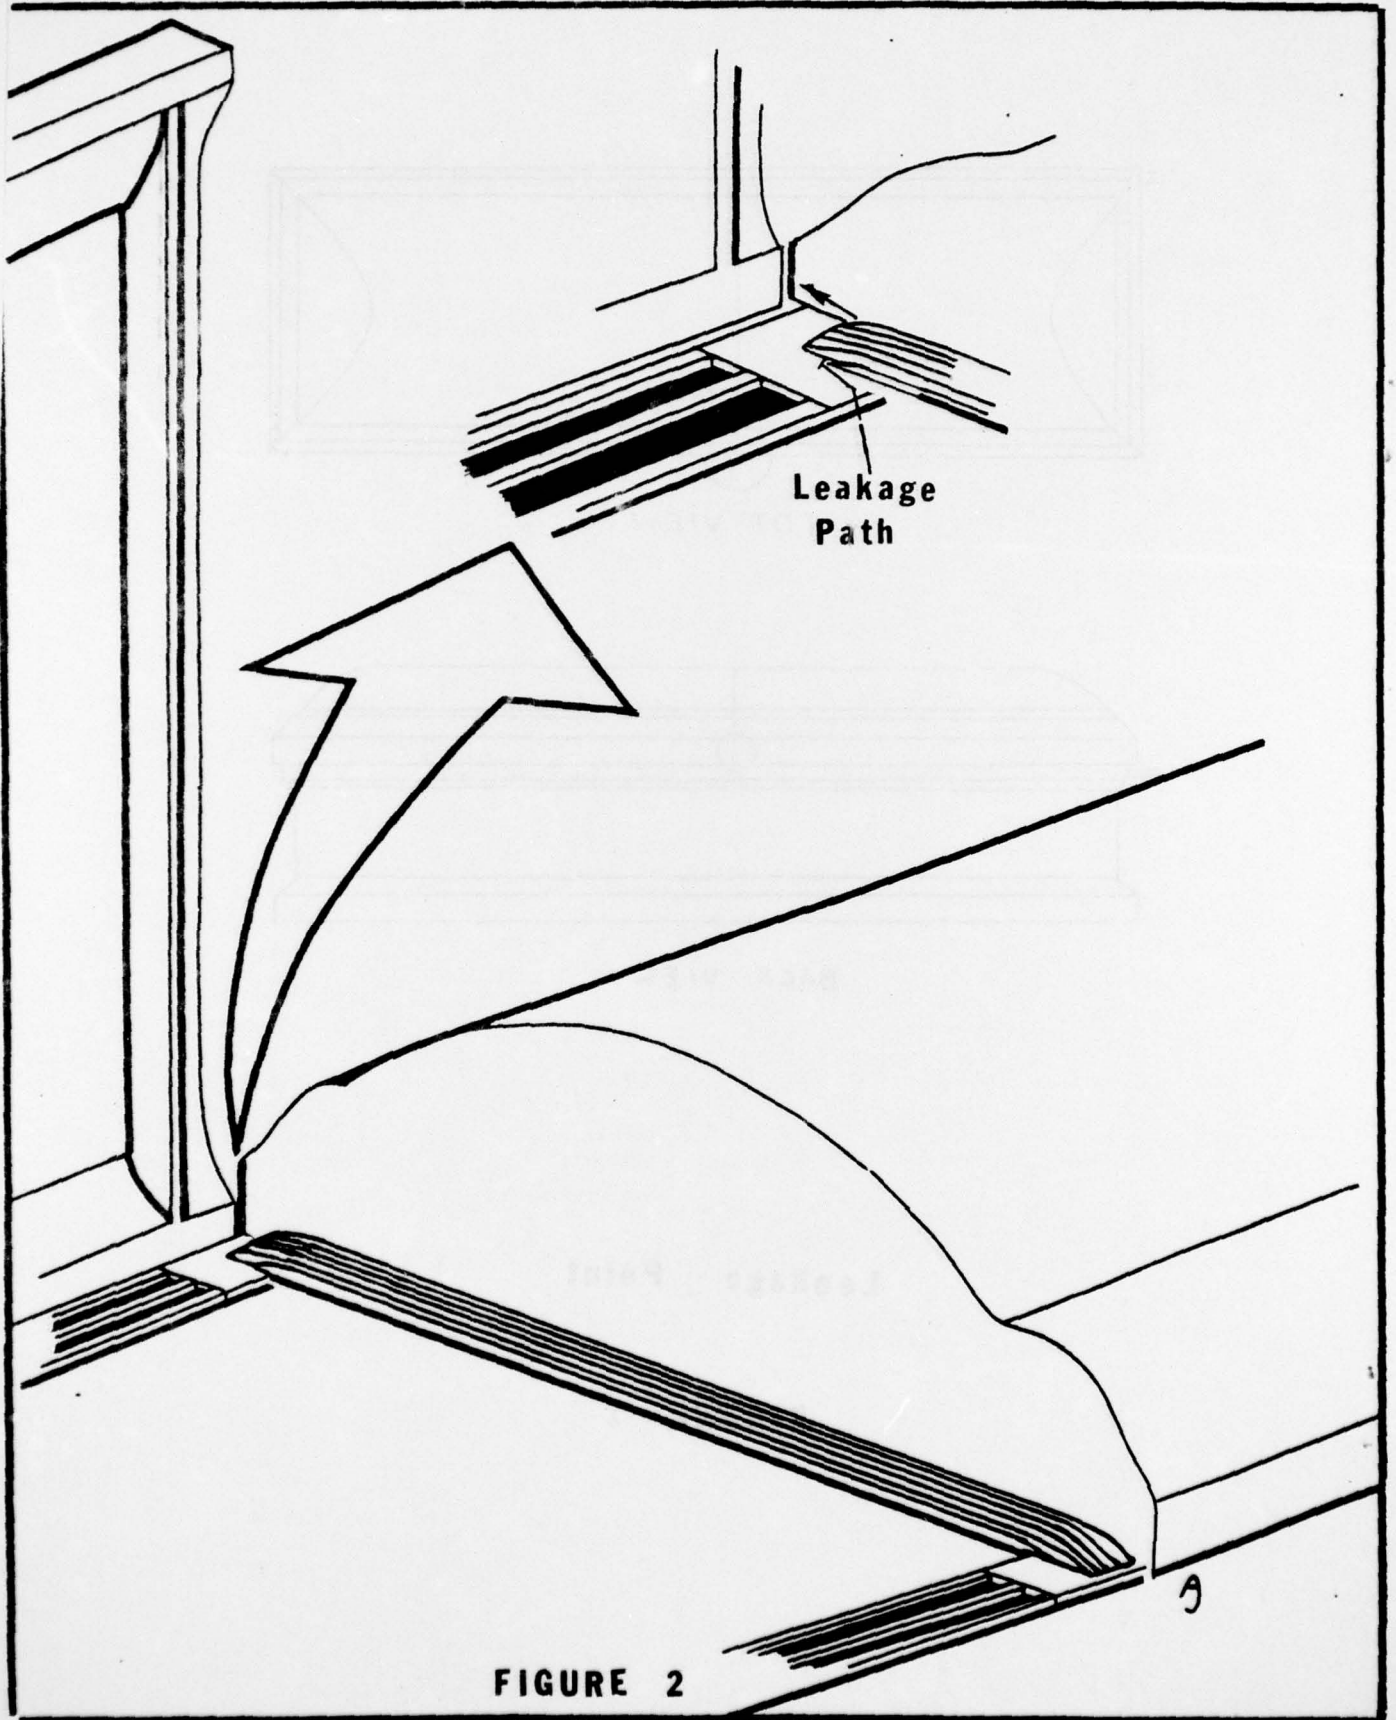



DISTRIBUTION LIST

AFALD/PT	2
AFALD/PTP	3
AFPEA Library	20
Defense Documentation Center	12
AFLC/DEHM	10
USAF/LGTN	2
Washington DC 20330	

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER 14 PTPD <del>██████████</del> -76-36	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) 6 AIRTIGHTNESS TEST OF CASKET FOR HUMAN REMAINS.	5. TYPE OF REPORT & PERIOD COVERED 9 Final rept. August 1976-September 1976	6. PERFORMING ORG. REPORT NUMBER AFPEA Report No. 76-P7-55
7. AUTHOR(s) 10 DARYL A. EDWARDS Engr Tech	8. CONTRACT OR GRANT NUMBER(s)	
9. PERFORMING ORGANIZATION NAME AND ADDRESS AFALD/PTPD (AFLC)✓ Design Division Wright-Patterson AFB OH 45433	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 12 8p.	
11. CONTROLLING OFFICE NAME AND ADDRESS AFALD/PTPD (AFLC) Design Division Wright-Patterson AFB OH 45433	12. REPORT DATE 10 Oct 1976	13. NUMBER OF PAGES
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	15. SECURITY CLASS. (of this report) Unclassified	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)  Approved for public release. Distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  Casket Airtightness test		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) A test for airtightness utilizing the Halogen Leak Detector was performed on a casket for human remains as requested by AFLC/DEHM (Memorial Affairs Division). The casket was a Batesville R58-845-A sealer casket, serial No. L-47446, supplied by the Batesville Casket Company, Inc., located in Batesville, Indiana. Although the casket leaked at one spot, it was concluded that satisfactory airtightness performance may readily be achieved.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

403 519

PRECEDING PAGE BLANK NOT FILMED